


# Delta C2000 VFD to Apollo III I/O Cable

1	
REVISIONS	

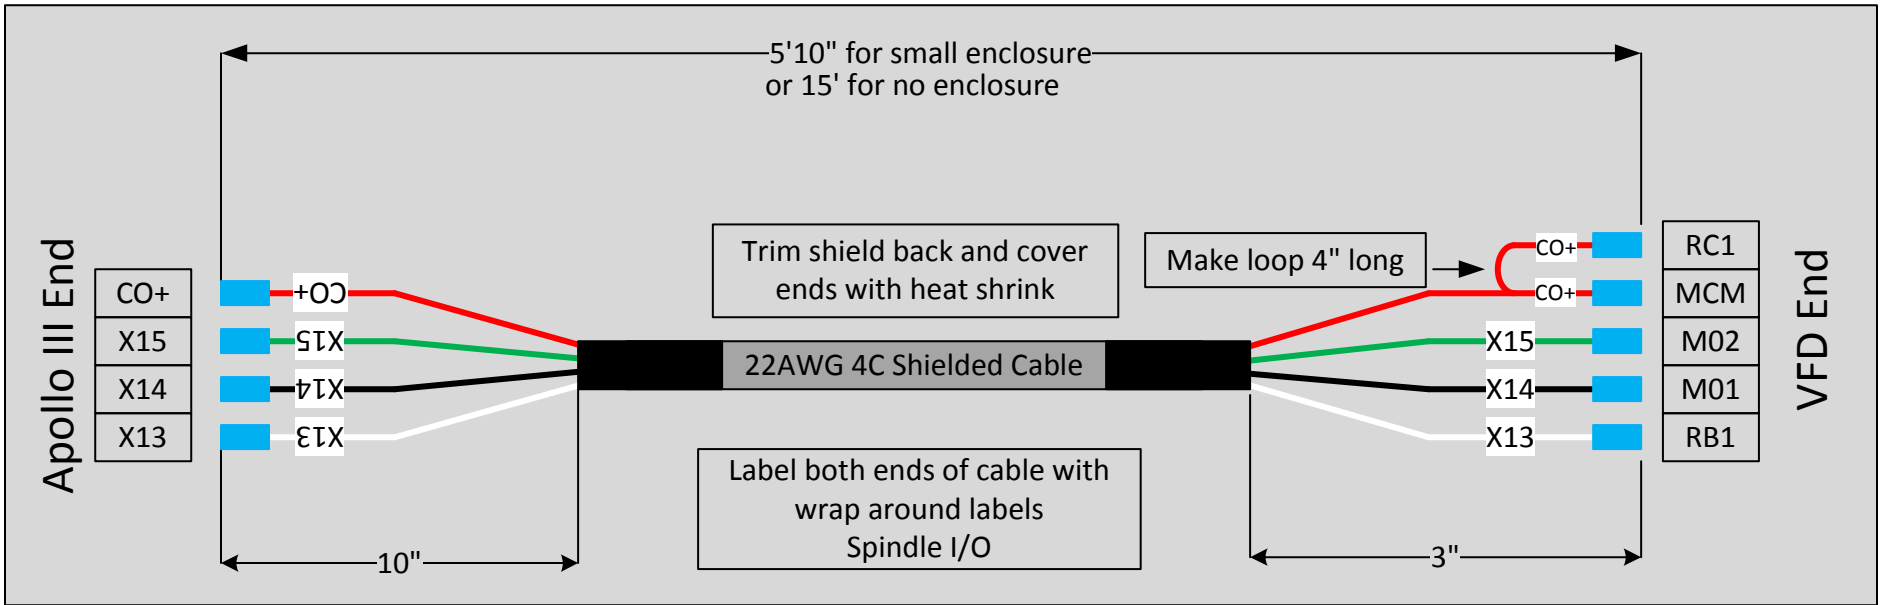

Use long uninsulated ferrules for VFD end of cable.  
( McMaster-Carr #9681K19)

Delta C2000 VFD Settings		
Parameter	Function	Setting
2-17	Inverter running	34
2-16	Up to Frequency	2
2-13	Fault Output	11

Function	Label	VFD Terminal(s)
24V	CO+	RC1,MCM
Spindle at Zero	X15	M02
Spindle at Speed	X14	M01
Spindle Fault	X13	RB1

	Delta C2000 VFD to Apollo III I/O Cable			
	SIZE	FSCM NO	DRAWING NUMBER	REV
	SCALE	SHEET		